

MARION COUNTY SURVEYOR'S OFFICE

SECTION CORNER RECORD



DEBRA S. JENKINS
MARION COUNTY SURVEYOR

SEC. 6 TWN. 15_N RNG. 3_E

BRYAN F. CATLIN, PLS
TECHNICAL SUPERVISOR

Date: 8-18-09
Party Chief: Wilcoxen
Crew: Finney
Type of Marker: Harrison
Method of Establishment: County: 9-4-1997
IN S.P.C. E Zone, NAD 83
Name: 15030601
N: 503 249.989 4(m)
E: 49 977.677 2(m)
15020103, 15030601, 16023609, &16033107
are all common corners with same coordinates.

ALSO 1-15-2
31-16-3
36-16-2

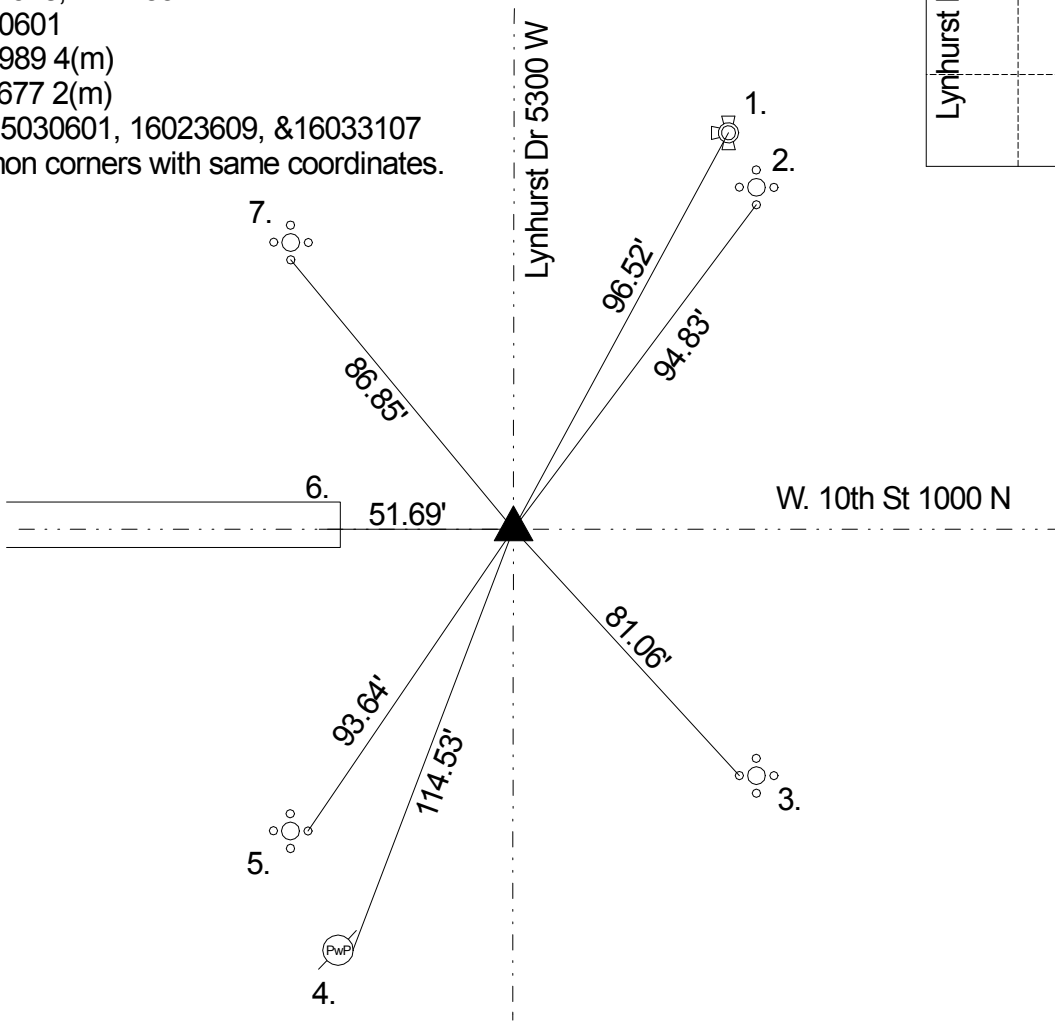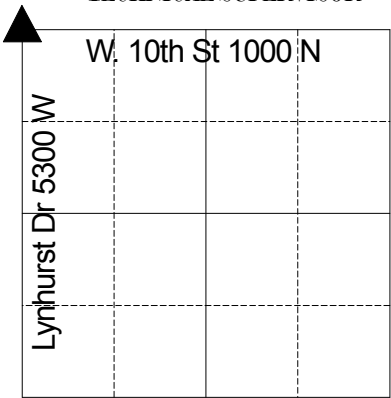

Corner originally set as a post in 1820 by Wm. Laughlin with the following witnesses: 10" hornbeam bearing N 17 W 27 links; 18" beech bearing S 65 W 25 links (Marion County Atlas pg. 2). A survey by R. Mayhew on 8-3-1859 indicates a stone fd underground and under stake (Wayne Legal Book pg. 21). A survey by H.B. Fatout on 3-20-1878 indicates a rock formerly set (wayne Legal Book pg. 21). Corner referenced by MCSO on 6-27-1940 and called a brass plug. Corner referenced by MCSO on 10-31-45 and called a brass plug. Corner referenced by Monroe on 3-1-58 and called a brass plug. Corner referenced by Burres on 8-15-63 and called same. Miller 6-3-75 called same. Cleveland 9-11-84 called same. Greene 4-5-90 called same. Wilcoxen 6-3-96 called same. Kiste 9-4-97 called same. Corner excavated by Wilcoxen on 10-18-1998 and a brass plug in steel cylinder was found. No other points found. A #205 cast iron Harrison monument was set in position as the corner. Retied 9-4-2003 by Wilcoxen. Retied 8-18-09 by Wilcoxen.

| REF. | DISTANCE | DESCRIPTION |
|------|----------|------------------------------------|
| 1. | 96.52' | Top nut of fire hydrant |
| 2. | 94.83' | Cut 'x' S bolt of signal pole base |
| 3. | 81.06' | Cut 'x' W bolt of signal pole base |
| 4. | 114.53' | Road nail E PwP #41-495 12" up |
| 5. | 93.64' | Cut 'x' E bolt of signal pole base |
| 6. | 51.69' | Due W to cut 'x' in median |
| 7. | 86.85' | Cut 'x' S bolt of signal pole base |
| | | |
| | | |